



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No 11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@gmail.com

Certificate Inflatable Liferaft

Cert.No : 112/MJAP/ILR/VIII/23

• Customer	: PT. PAN MARITIME WIRA PAWITRA	• Name Of Ship	: CB. PAN MARINE 8
• Manufacturer	: SHANGHAI STAR RUBBER	• Carrying Capacity	: 25 Persons
• Liferaft Type	: RAFT - A - 25 (II)	• Date Of Manufacture	: 03 - 2006
• Serial No.	: A0625195	• Emergency Pack Type	: SOLAS A PACK
• CO ² Cylinder No.	Containing CO ²	Containing N ²	Total Wt
1. 210049	4,200 Kg	0,280 Kg	15,560 Kg
2. 209960	4,200 Kg	0,280 Kg	15,570 Kg

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition.
INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA (SOLAS) and
INTERNATIONAL LIFE - SAVING APPLIANCE (LSA) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 28 Agustus 2023
- Date Of next inspection : 27 Agustus 2024



For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector
At PT. MEGA JAYA ABADI PERKASA



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538
Fax (021) 440 8538 E-mail : megajayaabadi@gmail.com

LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amendment to Resolution A.761(18)

Certificate No.: 112/MJAP/VIII/23

GENERAL PARTICULARS			
Name Of Ship	CB. PAN MARINE 8	Nationality/Port of Registry	INDONESIA
Owner	PT. PAN MARITIME WIRA PAWITRA	Call Sign	YDA4696
IMO-No	9483592	MMSI No	525016204
Class		Date of Service	28 Agustus 2023
Kind Of Service			
☒ Annual ☒ 5 Yearly ☒ Repair			

REMARKS :

" Food Ration, Drinking Water, Smoke Signal, Parachute Signal, Redhand Flares, Anti Seasickness, Batteries, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beckets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Conduit	OK	Torch, Signaling	OK
LD Container	RN	Operating Head	OK	Spare Batteries	RN
Valise Fabric/Plastic	RN	SURVEY OF INTERIOR		Whistle	OK
Eyelets	OK	Buoyncies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Sharpping	RN	Thwart Fabric	NA	Spare Bulb For Torch	OK
SURVEY OF EXTERIOR		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyncies,Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridle / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	• EMERGENCY PACK •	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	08/2026 RN
Seam and Taping	OK	Topping Up Valves	NA	Drinking Water	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	08/2026 RN
Exterior Lmghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	08/2026 RN
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	08/2026 RN
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	08/2026 RN
Cylinder Pockets	OK	ACCESSORY BAG	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	09/2024 OK
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	08/2025 RN

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

** Working Code : (RP = Repair) , (RN = Renewed) , (OK = Good) , (EXP = Expired) , (SP = Supply) , (CH = Charge) **



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax: (021) 440 8538 E-mail: megajayaabadi@gmail.com

Certificate No.: 112/MJAP/VIII/23

RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO² Kg	Weight of N² Kg	Total Weight Kg
Cylinder No.1	210049						4,200	0,280	15,560
Cylinder No.2	209960						4,200	0,280	15,570
DAVID LAUNCHABLE RAFT	Remarks	RES:A 761(18)		Remarks					
Load Test Date:	-	WP-TEST		YES		28/08/2023			
Suspension Straps/Patches	-	FS-TEST							
Shackle	-	NAP-TEST							
Steering Line With Patches	-	GI-TEST							
Bowsing Line With Patches	-	RAFT		Serial No.	A0625195		Man of date : 03 - 2006		
Container Line Incl. Pocket	-			Type	RAFT - A - 25 (II)		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	SHANGHAI STAR RUBBER				
"RAFT IN GOOD CONDOTION"									

Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam



	
Surveyor	AGUS FERİYANSYAH
Next Inspection Date	27 AGUSTUS 2024

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara
Telp. (021) 440 8538 Fax. (021) 440 8538
E-mail : megajayaabadi@ymail.com

Certificate Inflatable Liferaft

Cert.No : 113/MJAP/ILR/VIII/23

- | | | | |
|--------------------------------|---------------------------------|---------------------------|--------------------|
| • Customer | : PT. PAN MARITIME WIRA PAWITRA | • Name Of Ship | : CB. PAN MARINE 8 |
| • Manufacturer | : SHANGHAI STAR RUBBER | • Carrying Capacity | : 25 Persons |
| • Liferaft Type | : RAFT - A - 25 (II) | • Date Of Manufacture | : 11 - 1998 |
| • Serial No. | : 81222 | • Emergency Pack Type | : SOLAS A PACK |
| • CO ² Cylinder No. | Containing CO ² | Containing N ² | Total Wt |
| 1. 974314 | 4,200 Kg | 0,280 Kg | 15,560 Kg |
| 2. 974332 | 4,200 Kg | 0,280 Kg | 15,570 Kg |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition.
INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA (SOLAS) and
INTERNATIONAL LIFE - SAVING APPLIANCE (LSA) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction,
and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction,
end the log card has been endorsed accordingly.

- Date Of Issue : 28 Agustus 2023
- Date Of next inspection : 27 Agustus 2024



For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector
At PT. MEGA JAYA ABADI PERKASA



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail: megajayaabadi@gmail.com

LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amendment to Resolution A.761(18)

Certificate No.: 113/MJAP/VIII/23

GENERAL PARTICULARS			
Name Of Ship :	CB. PAN MARINE 8	Nationality/Port of Registry :	INDONESIA
Owner :	PT. PAN MARITIME WIRA PAWITRA	Call Sign :	YDA4696
IMO-No :	9483592	MMSI No :	525016204
Class :	-	Date of Service :	28 Agustus 2023
Kind Of Service			
☒ Annual ☒ 5 Yearly ☒ Repair			

REMARKS :

" Food Ration, Smoke Signal, Parachute Signal, Redhand Flares, Anti Seasickness, Batteries, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Conduit	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	RN
Valise Fabric/Plastic	RN	SURVEY OF INTERIOR		Whistle	OK
Eyelets	OK	Buoyncies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart Fabric	NA	Spare Bulb For Torch	OK
SURVEY OF EXTERIOR		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyncies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridle / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	• EMERGENCY PACK •	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	08/2026
Seam and Taping	OK	Topping Up Valves	NA	Drinking Water	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	09/2025
Exterior Lighting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	08/2026
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	08/2026
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	08/2026
Cylinder Pockets	OK	ACCESSORY BAG	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	09/2024
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	08/2025

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

** Working Code : (RP = Repair) , (RN = Renewed) , (OK = Good) , (EXP = Expired) , (SP = Supply) , (CH = Charge) **



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 113/MJAP/VIII/23

RAFT AND CYLINDER TEST


PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droc (mmHg)	Blow Off (mmhg)	Rescat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO² Kg	Weight of N³ Kg	Total Weight Kg
Cylinder No.1	974314		-		-	-	4,200	0,280	15,560
Cylinder No.2	974332		-		-	-	4,200	0,280	15,570
DAVID LAUNCHABLE RAFT	Remarks	RES:A 761(18)		Remarks					
Load Test Date:	-	WP-TEST		YES		28/08/2023			
Suspension Straps/Patches	-	FS-TEST		-					
Shackle	-	NAP-TEST		-					
Steering Line With Patches	-	GI-TEST		-					
Bowsing Line With Patches	-	RAFT		Serial No.		81222		Man of date : 11 - 1998	
Container Line Incl. Pocket	-			Type		RAFT - A - 25 (II)		Capacity : 25 Persons	
Pocket for Steering/Bowsing Lines	-			Merk		SHANGHAI STAR RUBBER			
"RAFT IN GOOD CONDOTION"									

Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

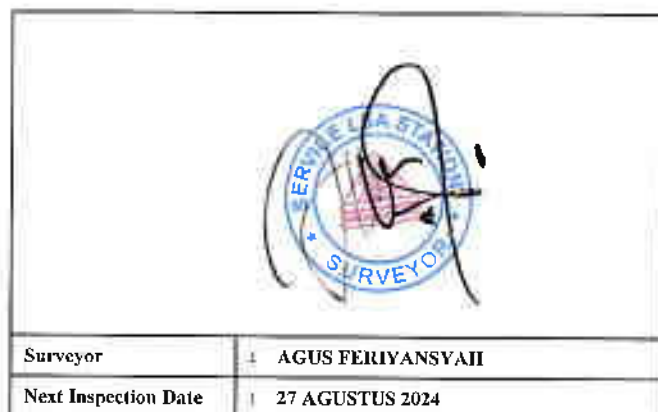

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara
Telp (021) 440 8538 Fax. (021) 440 8538
E-mail : megajayaabadi@ymail.com

Certificate Inflatable Liferaft

Cert.No : 114/MJAP/ILR/VIII/23

- | | | | |
|--------------------------------|---------------------------------|---------------------------|--------------------|
| • Customer | : PT. PAN MARITIME WIRA PAWITRA | • Name Of Ship | : CB. PAN MARINE 8 |
| • Manufacturer | : SHANGHAI STAR RUBBER | • Carrying Capacity | : 25 Persons |
| • Liferaft Type | : RAFT - A - 25 (II) | • Date Of Manufacture | : 03 - 2003 |
| • Serial No. | : A031079 | • Emergency Pack Type | : SOLAS A PACK |
| • CO ² Cylinder No. | Containing CO ² | Containing N ² | Total Wt |
| 1. 075913 | 4,200 Kg | 0,280 Kg | 15,560 Kg |
| 2. 075981 | 4,200 Kg | 0,280 Kg | 15,570 Kg |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA (SOLAS) and INTERNATIONAL LIFE - SAVING APPLIANCE (LSA) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 28 Agustus 2023
- Date Of next inspection : 27 Agustus 2024



For and on behalf of



FERIYANSYAH

Approved Signatory for chief inspector
At PT. MEGA JAYA ABADI PERKASA



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax: (021) 440 8538 E-mail: megajayaabadi@gmail.com

LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amendment to Resolution A.761(18)

Certificate No.: 114/MJAP/VIII/23

GENERAL PARTICULARS			
Name Of Ship	: CB. PAN MARINE 8	Nationality/Port of Registry	: INDONESIA
Owner	: PT. PAN MARITIME WIRA PAWITRA	Call Sign	: YDA4696
IMO-No	: 9483592	MMSI No	: 525016204
Class	: -	Date of Service	: 28 Agustus 2023
Kind Of Service			
☒ Annual ☒ 5 Yearly ☒ Repair			

REMARKS :

" Smoke Signal, Parachute Signal, Redhand Flares, Anti Seasickness, Batteries, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"I/Y" Place Connector	OK	Sponges	OK
Handling Beckets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Conduit	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	RN
Valise Fabric/Plastic	RN	SURVEY OF INTERIOR		Whistle	OK
Eyelets	OK	Buoynancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
SURVEY OF EXTERIOR		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoynancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridle / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	* EMERGENCY PACK *	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	09/2025
Seam and Taping	OK	Topping Up Valves	NA	Drinking Water	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	09/2025
Exterior Lighting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	08/2026
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	08/2026
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	08/2026
Cylinder Pockets	OK	ACCESSORY BAG	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	09/2024
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Rall		Repair Kit	OK	Expired Date	08/2025

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

** Working Code : (RP = Repair) , (RN = Renewed) , (OK = Good) , (EXP = Expired) , (SP = Supply) , (CH = Charge) **



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 114/MJAP/VIII/23

RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reset (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO² Kg	Weight of N² Kg	Total Weight Kg
	Cylinder No.1		075913		-	-	4,200	0,280	15,560
	Cylinder No.2		075981		-	-	4,200	0,280	15,570
DAVID LAUNCHABLE RAFT	Remarks	RES:A 761(18)		Remarks					
Load Test Date: Suspension Straps/Patches Shackle Steering Line With Patches Bowsing Line With Patches Container Line Incl. Pocket Pocket for Steering/Bowsing Lines	-	WP-TEST		YES		28/08/2023			
	-	FS-TEST		-		-			
	-	NAP-TEST		-		-			
	-	GI-TEST		-		-			
	-	RAFT	Serial No.		A031079		Man of date : 03 - 2003		
	-		Type		RAFT - A - 25 (11)		Capacity : 25 Persons		
	-		Merk		SHANGHAI STAR RUBBER				
"RAFT IN GOOD CONDOTION"									

Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam



Surveyor : AGUS FERİYANSYAH

Next Inspection Date : 27 AGUSTUS 2024

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara
Telp. (021) 440 8538 Fax. (021) 440 8538
E-mail : megajayaabadi@ymail.com

Certificate Inflatable Liferaft

Cert.No : 115/MJAP/ILR/VIII/23

• Customer	: PT. PAN MARITIME WIRA PAWITRA	• Name Of Ship	: CB. PAN MARINE 8
• Manufacturer	: JIANGSU HAINING	• Carrying Capacity	: 65 Persons
• Liferaft Type	: HNF HSC - 65	• Date Of Manufacture	: 12 - 2000
• Serial No.	: A031079	• Emergency Pack Type	: SOLAS B PACK
• CO ² Cylinder No.	Containing CO ²	Containing N ²	Total Wt
1. 982867	9,500 Kg	1,000 Kg	25,120 Kg
2. 982079	9,500 Kg	1,000 Kg	25,160 Kg

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA (SOLAS) and INTERNATIONAL LIFE - SAVING APPLIANCE (LSA) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 28 Agustus 2023
- Date Of next inspection : 27 Agustus 2024



For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector
At PT. MEGA JAYA ABADI PERKASA



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax (021) 440 8538 E-mail megajayaabadi@gmail.com

LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amendment to Resolution A.761(18)

Certificate No.: 115/MJAP/VIII/23

GENERAL PARTICULARS

Name Of Ship : CB. PAN MARINE 8	Nationality/Port of Registry : INDONESIA
Owner : PT. PAN MARITIME WIRA PAWITRA	Call Sign : YDA4696
IMO-No : 9483592	MMST No : 525016204
Class : 1	Date of Service : 28 Agustus 2023
Kind Of Service	
☒ Annual	☒ Yearly
☒ Repair	

REMARKS :

"Food Ration, Drinking Water, Smoke Signal, Parachute Signal, Redhand Flares, Anti Seasickness, Batteries, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beckets	OK	Protection Pads	OK	Bailers	-
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Conduit	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	RN
Valise Fabric/Plastic	RN	SURVEY OF INTERIOR		Whistle	OK
Eyelets	OK	Buoys/Fabric	OK	Fishing Kit	-
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	-
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	-
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
SURVEY OF EXTERIOR		Deflation Plugs/Valves	OK	Drinking Vessel	-
Buoys/Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	-
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	-
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	-
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	-
Towing Bridle / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	* EMERGENCY PACK *	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	08/2026
Seam and Taping	OK	Topping Up Valves	NA	Drinking Water	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	08/2026
Exterior Lighting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	08/2026
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quota	OK	Expired Date	08/2026
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	08/2026
Cylinder Pockets	OK	ACCESSORY BAG	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	09/2024
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	08/2025

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

** Working Code : (RP = Repair), (RN = Renewed), (OK = Good), (EXP = Expired), (SP = Supply), (CH = Charge) **



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 115/MJAP/VIII/23

RAFT AND CYLINDER TEST

RAFT AND CYLINDER TEST									
PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO ² Kg	Weight of N ² Kg	Total Weight Kg
Cylinder No.1	982867		-		-	-	9,500	1,000	25,120
Cylinder No.2	982079		-		-	-	9,500	1,000	25,160
DAVID LAUNCHABLE RAFT	Remarks	RES-A 761(18)		Remarks					
Load Test Date:	-	WP-TEST		YES		28/08/2023			
Suspension Straps/Patches	-	FS-TEST		-		-			
Shackle	-	NAP-TEST		-		-			
Steering Line With Patches	-	GI-TEST		-		-			
Bowsing Line With Patches	-	RAFT		Serial No.		00023		Man of date : 12 - 2000	
Container Line Incl Pocket	-			Type		HNF HSC - 65		Capacity : 65 Persons	
Pocket for Steering/Bowsing Lines	-			Merk		JIANGSU HAINING			
"RAFT IN GOOD CONDOTION"									

Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam



Surveyor : AGUS FERIYANSYAH

Next Inspection Date : 27 AGUSTUS 2024

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No 11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@gmail.com

Certificate Inflatable Liferaft

Cert.No : 116/MJAP/ILR/VIII/23

- Customer : PT. PAN MARITIME WIRA PAWITRA
 - Name Of Ship : CB. PAN MARINE 8
 - Manufacturer : SHANGHAI DACHENG RUBBER
 - Carrying Capacity : 65 Persons
 - Liferaft Type : (96) HYF - 65
 - Date Of Manufacture : 03 - 2002
 - Serial No. : 007
 - Emergency Pack Type : SOLAS B PACK
- | • CO ² Cylinder No. | Containing CO ² | Containing N ² | Total Wt |
|--------------------------------|----------------------------|---------------------------|-----------|
| 1. 975678 | 9,500 Kg | 1,000 Kg | 25,120 Kg |
| 2. 975654 | 9,500 Kg | 1,000 Kg | 25,160 Kg |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition.
INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA (SOLAS) and
INTERNATIONAL LIFE - SAVING APPLIANCE (LSA) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, and the log card has been endorsed accordingly.

- Date Of Issue : 28 Agustus 2023
- Date Of next inspection : 27 Agustus 2024

For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector

At PT. MEGA JAYA ABADI PERKASA





PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 116/MJAP/VIII/23

GENERAL PARTICULARS			
Name Of Ship	CB. PAN MARINE 8	Nationality/Port of Registry	INDONESIA
Owner	PT. PAN MARITIME WIRA PAWITRA	Call Sign	YDA4696
IMO-No	9483592	MMSI No	525016204
Class		Date of Service	28 Agustus 2023
Kind Of Service			
☒ Annual ☒ 5 Yearly ☒ Repair			

REMARKS :

"Food Ration, Drinking Water, Smoke Signal, Parachute Signal, Redhand Flares, Anti Seasickness, Batteries, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	-
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Conduit	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	RN
Valise Fabric/Plastic	RN	SURVEY OF INTERIOR		Whistle	OK
Eyelets	OK	Buoynancies Fabric	OK	Fishing Kit	-
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	-
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	-
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
SURVEY OF EXTERIOR		Deflation Plugs/Valves	OK	Drinking Vessel	-
Buoynancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	-
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	-
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	-
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	-
Towing Bridle / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	* EMERGENCY PACK *	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	08/2026
Seam and Taping	OK	Topping Up Valves	NA	Drinking Water	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	08/2026
Exterior Lighting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	08/2026
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	08/2026
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	08/2026
Cylinder Pockets	OK	ACCESSORY BAG	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	09/2024
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	08/2025

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

** Working Code : (RP = Repair) , (RN = Renewed) , (OK = Good) , (EXP = Expired) , (SP = Supply) , (CH = Charge) **



PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538
Fax (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 116/MJAP/VIII/23

RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Preasure (mmHg)	Time	Temp (°C)	Preasure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Rescat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO² Kg	Weight of N² Kg	Total Weight Kg
Cylinder No.1	975678		-		-	-	9,500	1,000	25,120
Cylinder No.2	975654		-		-	-	9,500	1,000	25,160
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks					
Load Test Date:	-	WP-TEST		YES		28/08/2023			
Suspension Straps/Patches	-	FS-TEST		-		-			
Shackle	-	NAP-TEST		-		-			
Steering Line With Patches	-	GI-TEST		-		-			
Bowsing Line With Patches	-	RAFT		Serial No.		007		Man of date : 03 - 2002	
Container Line Incl. Pocket	-			Type		(96) HYF - 65		Capacity : 65 Persons	
Pocket for Steering/Bowsing Lines	-			Merk		SHANGHAI DACHENG RUBBER			
"RAFT IN GOOD CONDOTION"									

Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,

Ad. KA. KANTOR KESYAHBANDARAN UTAMA TO, PRUK
KABID. STATUS HUKUM DAN SERTIFIKASI KAPAL

U.S.

KASIE. SERTIFIKASI KESELAMATAN KAPAL



RANMATESHIA

NIP. 19631017 200402 1 001





Surveyor	: AGUS FERİYANSYAH
Next Inspection Date	: 27 AGUSTUS 2024

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "